

Date: Wednesday, 29/10/2008 4:20:59 PM  
 User: Julie Dawson

## Process Sheet

Customer : CU-DAR001 Dart Helicopters Services Drawing Name : SKID TUBE ASSEMBLY  
 Job Number : 43082  
 Estimate Number : 10023  
 P.O. Number : Part Number : D205634041  
 This Issue : 29/10/2008 S.O. No. : Drawing Number : D2580 REV D  
 Prsht Rev. : NC Project Number : N/A  
 First Issue : / / Type : SKIDTUBES Drawing Revision : D  
 Previous Run : 43081 Material :  
 Due Date : 10/11/2008 Qty: 1 Um: Each  
 Written By :  
 Checked & Approved By : JUD 08.10.30  
 Comment : Est Rev:N 02.08.28 FP was QC5 in Step 27; Added QC5 to Step  
 30 KJ  
 Est Rev: O 06.02.28 Added paperwork EC  
 Est Rev:P 07-07-09 SS Wearplates & Gaskets JLM

## Additional Product

Job Number:



Seq. #: Machine Or Operation: Description :

1.0 DC DOCUMENT CONTROL



for JUD 08.11.27



Comment: DOCUMENT CONTROL

Photocopy D205-634 bluefile &amp; type labels per PPP D205-634-041 CHG002

Soshul27

2.0 D25001190 Extn -I' Beam Tube 4"



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number Description Batch  
 1 D2500-1-190 Skid Tube Extrusion

B-401502

AWM 8-11-07

3.0 D2596 Web, 205 Skidtube



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number Description Batch  
 1 D2596 205 Web

B73108

43250?

AWM 8-11-07

4.0 SKIDTUBES 1 SKIDTUBESS RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1- Inspect mat'l D2500-1-190 for damage

2-Cut D2500-1-190 per Dwg D2580 if necessary Deburrr ends

3-Acid etch and Alodine tube per QSI 005 4.1

AWM 8-11-07

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

Date: Wednesday, 29/10/2008 4:20:59 PM  
User: Julie Dawson

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 43082

Part Number: D205634041

Job Number:



Seq. #:

Machine Or Operation:

Description :

5.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

① M 2-11-3

6.0

SKIDTUBES 1

SKIDTUBESS RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Drill pilot holes using drill jig DT 8149(Do not use cutting fluid)

2-Open holes to 0.500" as per Dwg D2580without cutting fluid

3-Countersink holes as per Dwg D2580without cutting fluid

4-Deburr and blow out all chips from inside of tube

5-Bond web in place per QSI 015. Allow 12 Hrs. cure time before cutting

Pick:

Qty Part Number Description Batch

A/R Sikaflex-291 M109449

Sikaflex expire date: 8-12-30

Start Time: 10:23 Date: 8-11-04

Fin Time: 7:00 Date: 8-11-05

AWM  
8-11-04

AWM 8-11-04

7.0

BENDING

BENDING MACHINE - SKIDTUBES



Comment: BENDING MACHINE

1-Bend as per program D2580.C on CNC Bender and Folio FT009

2-Cut tubes as per Dwg. D2580

RT 08-11-05

8.0

SKIDTUBES 1

SKIDTUBESS RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Deburr ends

2-Prepare tube for welding, remove alodine as required.

AWM 8-11-05

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector
	1							
	2							

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

Date: Wednesday, 29/10/2008 4:21:00 PM  
User: Julie Dawson

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 43082

Part Number: D205634041

Job Number:



Seq. #:

Machine Or Operation:

Description :

9.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

BE 08/11/10

10.0

D25763

Step (maching detail)



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty	Part Number	Description	Batch
1	D2576-3	Step	38392

BE 08/11/11

11.0

D2579

Crossbolt Spacer



Comment: Qty.: 20.0000 Each(s)/Unit Total: 20.0000 Each(s)

Pick:

Qty	Part Number	Description	Batch
20	D2579	Spacers	B-41432

AWM 8-11-05 20PCS\*

12.0

SKIDTUBES 1

SKIDTUBESS RESOURCE 1



Comment: LARGE FABRICATION RESOURCE 1

2-Weld step D2576 as per Dwg. D2580 and QSI 004.

A/R

Aluminum Rod

M107813

BE 08/11/11

3-Weld crossbolt spacers D2579 as per Dwg. D2580 and QSI 004.

For D2579 spacers, weld one side, pass 3/8" drill, weld other side, pass 3/8" drill

A/R

Aluminum Rod

M107813

BE 08/11/11

4-Grind welds as per Dwg D2580 Grind flush ridge made from bending

JB 8-11-11

5-Drill holes for wearplates using DT 8217 & DT8937 Open holes to 19/64", adjust stopper not to hit web. Debur

6-Counterbore crossbolt spacers to 7/16" ID x 1.0" deep as per Dwg D2580. Debur holes

JB 8-11-11

7-Drill pilot holes for aft cap using DT 8215 Open holes to 0.208". Debur

8-Drill pilot holes for Tow ring using DT8091, open to .640" and Debur

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

Date: Wednesday, 29/10/2008 4:21:00 PM  
User: Julie Dawson

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 43082

Part Number: D205634041

Job Number:



Seq. #:

Machine Or Operation:

Description :

13.0

QC10

VISUAL INSPECTION OF GROUND WELDS



Comment: VISUAL INSPECTION OF GROUND WELDS

08-11-12

14.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

08-11-12

15.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1  
Pressure wash as per QSI 005

FL 08/11/21

16.0

POWDER COATING

POWDER COATING



Comment: POWDER COATING  
Powder Coat White Gloss (Ref: 4.3.5.1) as per QSI 005 4.3

M 109152

(1X)

START TIME:

OVEN TEMPERATURE:

FINISH TIME:

10:30  
320°F  
11:00

M-L 08/11/21

17.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

HL

08-11-25

(X)

18.0

D2855

Cap



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Cap

Batch:

B42343

HL

19.0

AN35A

Bolt



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

Bolt

Batch:

M100188

HL

08-11-25

(X)

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries



Date: Wednesday, 29/10/2008 4:21:00 PM  
User: Julie Dawson

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 43082

Part Number: D205634041

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

20.0	AN960JD10L	Washer
------	------------	--------



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

Washer

Batch: M1105793

JW

21.0	ALS71032130	Insert
------	-------------	--------



Comment: Qty.: 50.0000 Each(s)/Unit Total: 50.0000 Each(s)

Insert

Batch: M1105819

JW X

22.0	AN3C4A	BOLT
------	--------	------



Comment: Qty.: 50.0000 Each(s)/Unit Total: 50.0000 Each(s)

BOLT

Batch: M1109431

JW

23.0	AN960C10L	washer
------	-----------	--------



Comment: Qty.: 50.0000 Each(s)/Unit Total: 50.0000 Each(s)

washer

Batch: M109798

JW

24.0	D356613	Gasket
------	---------	--------



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

GASKET

Batch: 1342943

JW

25.0	D35665	Gasket
------	--------	--------



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

GASKET

Batch: 1343264

JW

26.0	D35661	Gasket
------	--------	--------



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

GASKET

Batch: 1343264

JW

08-11-25 (X)

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

Date: Wednesday, 29/10/2008 4:21:00 PM  
User: Julie Dawson

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 43082

Part Number: D205634041

Job Number:



Seq. #:

Machine Or Operation:

Description :

27.0

D356413

Wearshoe



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

WEARSHOE

Batch: B41933

*ju*

28.0

D356411

Wearshoe



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

WEARSHOE

Batch: B43192

*ju*

29.0

D35649

Wearshoe



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

WEARSHOE

Batch: B42258

*ju*

30.0

D35645

Wearshoe



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

WEARSHOE

Batch: B42236

*ju*

31.0

D25943

O-Ring, 205 Skidtube



Comment: Qty.: 16.0000 Each(s)/Unit Total : 16.0000 Each(s)

O-Ring

Batch: B29908

*ju*

32.0

D25941

Plug, 205 Skidtube



Comment: Qty.: 16.0000 Each(s)/Unit Total : 16.0000 Each(s)

Plug

Batch: B401531

*ju*

33.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

1-Install inserts & wearplates & Gaskets as per Dwg. D2580. Use a drop of Sikaflex on insert holes before installing wearplates

A/R

Sikaflex-291

M109449

*ju*

08-11-25

*ju*

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

Date: Wednesday, 29/10/2008 4:21:00 PM  
User: Julie Dawson

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 43082

Part Number: D205634041

Job Number:



Seq. #:

Machine Or Operation:

Description :

✓ Sikaflex expire date: 08/11

✓ 2-Coat D2594-3 O' rings with Petroleum Jelly and install on D2594-1 plugs as per Dwg D2580

✓ 3-Inspect for foreign object per QSI 024

✓ 4-Install 2855 Aft Cap as per Dwg D2580 and seal Fwd Step & Aft Cap with Sikaflex. Clean excess adhesive

✓ A/R Sikaflex-291 M109449  
Sikaflex expire date: 08/11

5-Wing Walk as per Dwg D2580 and QSI 005 4.4

Batch: M109449

- Fd 08/11/25 ①

44  
08-11-25  
①

34.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: Inspect Aft Cap, Fwd Step and Wing Walk of work to Current Step Inspect for Foreign objects per QSI 024

35.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

 
Identify and pack for shipping as per PPP D205-634-041

Location:

PPP Rev:

Dev E I

Label checked HSP



SS 08/11/27

36.0

QC21

FINAL INSPECTION/W/O RELEASE



Comment: FINAL INSPECTION/W/O RELEASE

Job Completion



MF 08-11-27

B43082

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries



DESIGN #	DRAWN BY RH	<b>DART AEROSPACE LTD</b> HAWKESBURY, ONTARIO, CANADA	
CHECKED #	APPROVED #	DRAWING NO. D2580	REV. D SHEET 1 OF 3
DATE 07.02.27		TITLE 205 SKIDTUBE ASSEMBLY	SCALE NTS
A	96.09.16	NEW ISSUE	
B	96.12.02	AS MANUFACTURED	
C	98.08.26	REDRAWN, INCLUDED DEO 9094/9097	
D	07.02.27	CHANGE TO SS WEARPLATES AND GASKETS, INCLUDE DEO 9124/9183	

RELEASED  
07.06.28 #

QTY -041	QTY -045	Part Number	Description
X		D2580-041	SKIDTUBE ASSEMBLY
	X	D2580-045	SKIDTUBE ASSEMBLY
1	1	D2500-1-190	EXTRUSION
1	1	D2576-3	STEP
20	24	D2579	CROSS BOLT SPACER
16	16	D2594-1	PLUG
16	16	D2594-3	O-RING
1	1	D2596	205 WEB
1	1	D2855	AFT CAP
1	1	D3564-5	WEARSHOE
1	1	D3564-9	WEARSHOE
1	1	D3564-11	WEARSHOE
1	1	D3564-13	WEARSHOE
2	2	D3566-1	GASKET
1	1	D3566-5	GASKET
1	1	D3566-13	GASKET
50	50	ALS7-1032-130 or AKS7-1032-130 or AKS4-1032-130 or AELS-1032-130	INSERT
50	50	AN3C4A	BOLT
2	2	AN3-5A	BOLT
50	50	AN960C10L	WASHER
2	2	AN960JD10L	WASHER

**GENERAL NOTES:**


- 1) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED
- 2) ALL DIMENSIONS ARE IN INCHES
- 3) INSERT D2596 WEB TO LOCATION SHOWN OFF AFT END OF SKIDTUBE AND BOND WEB INTO OUTER TUBE WITH NON-STRUCTURAL SIKAFLEX-241 ADHESIVE PER DART QSI 015 BEFORE BENDING. ENSURE HOLES LINE-UP.
- 4) BEND AS A SMOOTH RADIUS STARTING WITH A MAXIMUM CENTERLINE RADIUS OF 60 AND ENDING WITH A MINIMUM RADIUS OF 30. A MAXIMUM REDUCTION OF 0.200 IN DIAMETER IS ALLOWABLE IN THE BENT PORTION OF THE TUBE.
- 5) USE DART DRILL TEMPLATE TD2577-205 TO LOCATE AND DRILL Ø0.297 HOLES FOR WEARSHOE INSERTS. INSTALL ALS7-1032-130 PER SECTION D-D (50 PLACES) AFTER FINISH. INSTALL AN3C4A BOLTS AND AN960C10L WASHERS WITH SIKAFLEX-241/-291.
- 6) WELDING TO BE DONE PER DART QSI 004.
- 7) FINISH:  
SEE NOTES ON  
PAGE 2 FOR D2580-041 AND  
PAGE 3 FOR D2580-045
- 8) INSERT D2594-1 PLUG C/W D2594-3 O-RING IN HOLES MARKED 'P' (BOTH SIDES OF TUBE) AFTER FINISH (16 PLACES).

SHOP COPY  
RETURN TO  
ENGINEERING  
UNCONTROLLED COPY  
SUBJECT TO AMENDMENT  
WITHOUT NOTICE  
WORK ORDER  
43080


Copyright © 1996 by DART AEROSPACE LTD

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.


**DETAIL A**  
SCALE 5:24

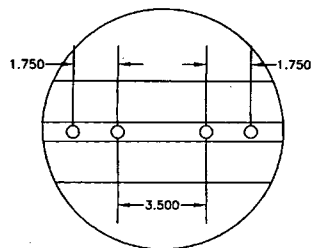


**DETAIL B**  
SCALE 5:24

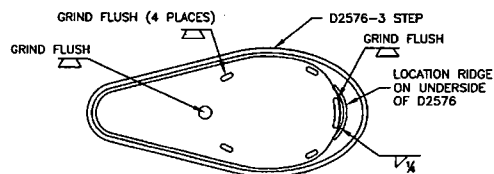


**D2580-1 DRILLING DETAIL**

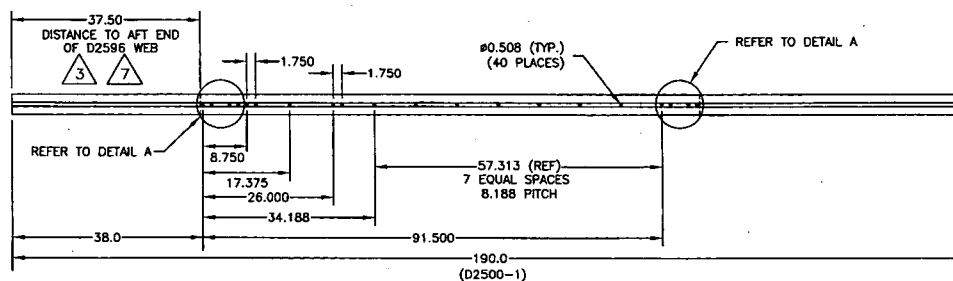


**D2580-1 BENDING AND CUTTING DETAIL**

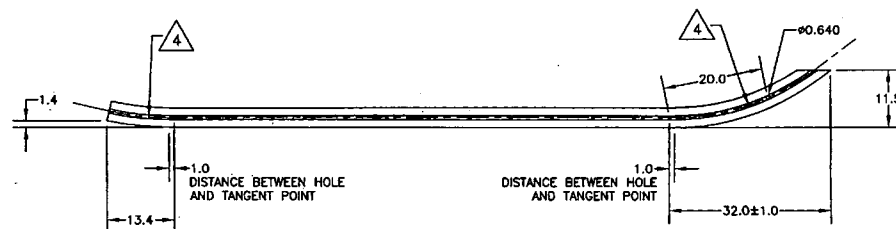


**D2580-041 ASSEMBLY DETAIL**

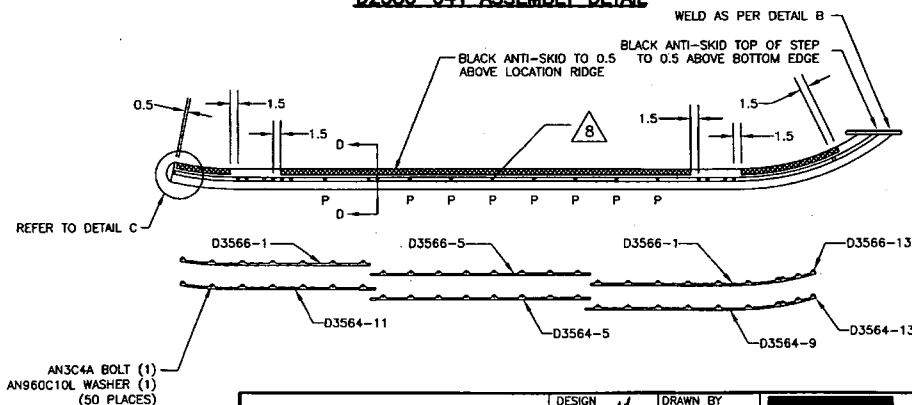

**DETAIL C**  
SCALE 5:24

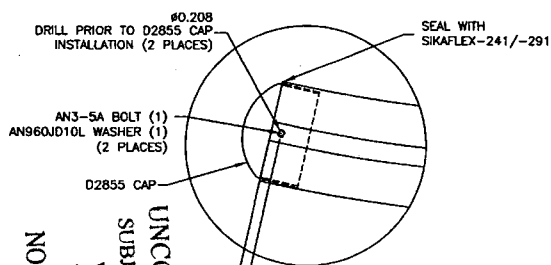

**SECTION D-D**  
SCALE 5:24

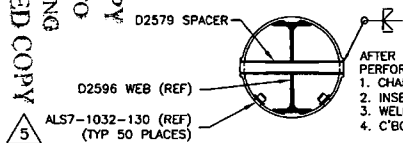

AFTER DRILLING AND BENDING ASSEMBLY PERFORM THE FOLLOWING FOR #0.508 HOLES ONLY:  
1. CHAMFER HOLE 0.050 X 45°  
2. INSERT D2579 SPACER (20 PLACES)  
3. WELD INTO PLACE AND GRIND FLUSH  
4. C'BORE D2579 SPACER TO #0.437 X 1.00 DEEP

**D2580-041 NOTES**

- i) FINISH: ACID ETCH, ALODINE PER DART QSI 005 4.1 PRIOR TO INSERTING D2596 WEB  
POWDER COAT ASSEMBLY GLOSS WHITE (REF. 4.3.5.1) PER DART QSI 005 4.3  
BLACK ANTI-SKID PAINT AS INDICATED PER DART QSI 005 4.4

COPYRIGHT © 1996 BY DART AEROSPACE LTD.

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

DESIGN	DRAWN BY	<b>DART</b>	DART AEROSPACE LTD.
CHECKED	APPROVED	DRAWING NO.	REV. 0
DATE	TITLE	D2580	SHEET 2 OF 3
07.02.27	205 SKIDTUBE ASSEMBLY	SCALE	1:24



Diagram of a circular cross-section of a pipe with four vertical stiffeners. The stiffeners are spaced 3.500 units apart. The distance from the centerline to the outer edge of the stiffeners is 1.750 units.

RELEASED  
07-06-28

Diagram illustrating the underside of the D2576 component, showing the location of the ridge and the grinding locations. The diagram includes labels for the GRIND FLUSH (4 PLACES), GRIND FLUSH, D2576-3 STEP, LOCATION RIDGE ON UNDERSIDE OF D2576, and a 1/4 inch dimension.

Diagram illustrating the rear view of the engine cover assembly. The diagram shows the location of the D2855 cap and the AN3-5A bolt. The cap is labeled "D2855 CAP" and the bolt is labeled "AN3-5A BOLT (1)". The washer is labeled "AN96JD10L WASHER (1)". The seal is labeled "SEAL WITH SIKAFLEX-241/-291". The diagram also includes a note "SEE NOTE ii)".

Diagram illustrating the assembly of a wheel component. The diagram shows a cross-section of a wheel with a central hub and spokes. Labels indicate the following parts and steps:

- D2579 SPACER**: Points to the central hub area.
- D2596 WEB (REF)**: Points to the spokes.
- 7-1032-130 (REF) (TYP 50 PLACES)**: Points to the outer rim.
- AFTER PERFO**: Points to the outer rim.

Steps for assembly:

1. CH
2. INS
3. WE
4. C'B

i) FINISH: ACID ETCH, ALODINE PER DART QSI 005 4.1 PRIOR TO INSERTING D2596 WEB  
POWDER COAT ENTIRE ASSEMBLY GREEN (REF. 4.3.5.8) PER DART QSI 005 4.3  
BLACK ANTI-SKID PAINT AS INDICATED PER DART QSI 005 4.4

ii) IT IS ACCEPTABLE TO GRIND A RELIEF IN THE D2855 AFT CAP TO PREVENT INTERFERENCE  
WITH THE SPACER AT THIS LOCATION

37.50  
DISTANCE TO AFT END  
OF D2596 WEB  
3 7  
REFER TO DETAIL A  
1.750  
1.750  
8.750  
17.375  
26.000  
34.188  
91.500  
190.0  
(D2500-1)  
#0.508 (TYP.)  
(40 PLACES)  
REFER TO DETAIL E  
57.313 (REF)  
7 EQUAL SPACES  
8.188 PITCH


(MAKE FROM D2580-1 DRILLING DETAIL)

Technical drawing of a curved bridge deck section. The drawing shows a plan view of a curved structure with various dimensions and callouts. Key dimensions include:

- Overall length: 51.340
- Distance from left end to center of curvature: 5.338 (REF)
- Distance from center of curvature to right end: 39.580
- Radius of curvature: 5.915
- Radius of hole:  $\phi 0.508$  (8 PLACES)
- Radius of hole:  $\phi 0.640$
- Distance between hole and tangent point: 1.0
- Distance between hole and tangent point: 1.0
- Overall width: 11.5
- Distance from left end to center of curvature: 1.4
- Distance from left end to center of curvature: 1.34
- Distance from center of curvature to right end: 32.0  $\pm$  1.0

Callouts include a triangle with the number 4, indicating a specific detail or material.

[illegible]

COPYRIGHT © 1996 BY DART AEROSPACE LTD.  THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	DESIGN	DRAWN BY	 DART AEROSPACE LTD. HAWKESBURY, ONTARIO, CANADA		
	CHECKED	APPROVED		DRAWING NO.	REV. 0
	DATE	TITLE			SHEET 3 OF 3
	07.02.27	205 SKIDTUBE ASSEMBLY			SCALE 1:24